

Front Axle Drive VAA350+


FD00046, FD00052, FD00054

OEM No: 0AV409053AE; 0AV409053AG; 0AV409053K

Brands

| Brand | Modelseries |
|-------|-----------------------|
| Skoda | Octavia; Superb; Yeti |

List of parts

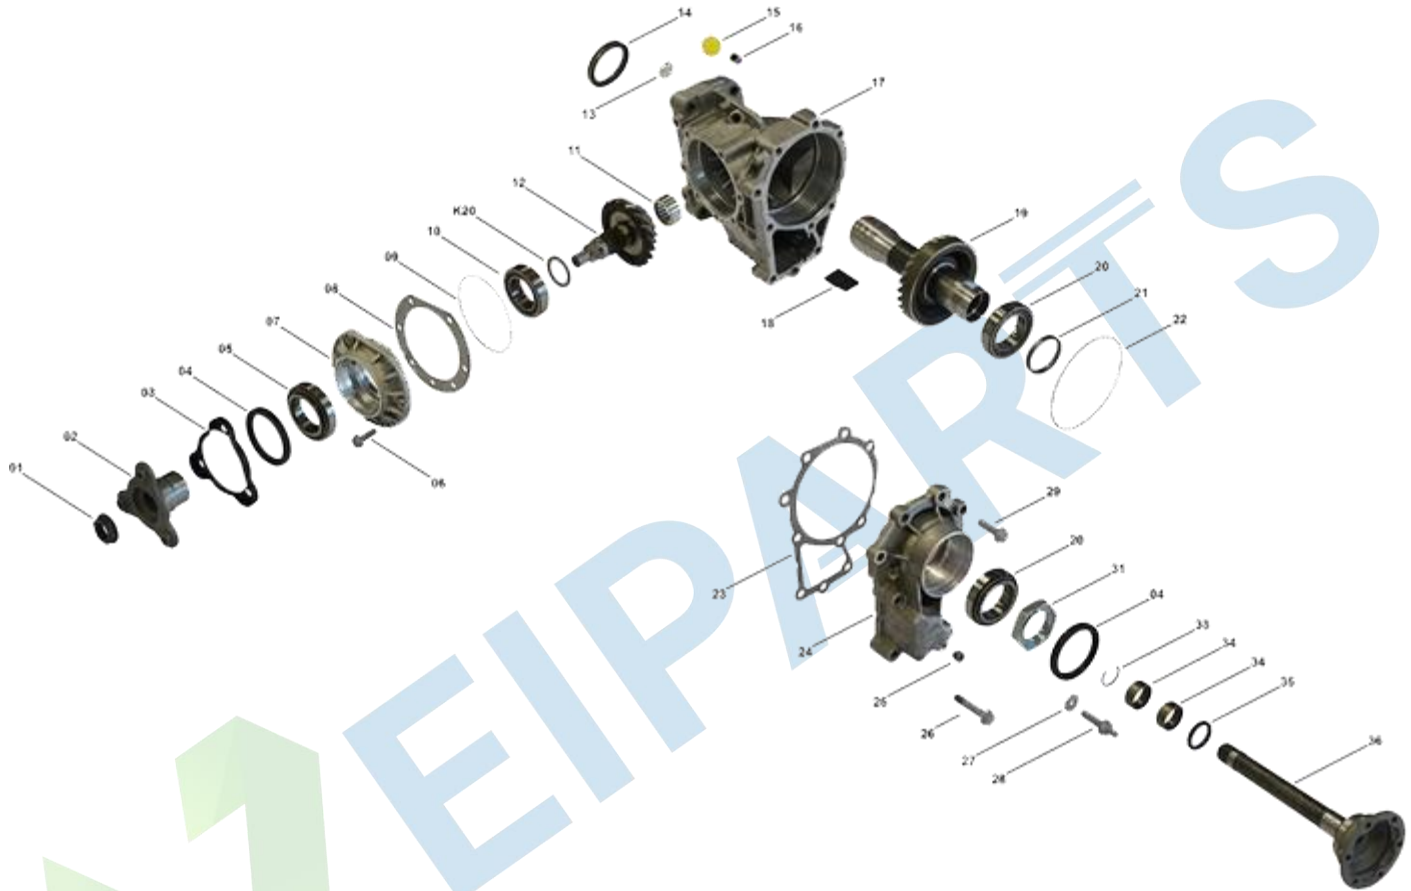

| Pos | Part number | OEM no | Quantity | Product name | Info |
|------|-------------|-------------|----------|---------------|--|
| 'I01 | FD00046 | 0AV409053K | | OE References | 0AV409053A, 0AV409053K |
| 'I02 | FD00052 | 0AV409053AE | | OE References | 02M409053AQ, 0AV409053H, 0AV409053P, 0AV409053S, 0AV409053AE |
| 'I03 | FD00054 | 0AV409053AG | | OE References | 0AV409053R, 0AV409053AA, 0AV409053AG |

Front Axle Drive VAA350+

FD00046, FD00052, FD00054

OEM No: 0AV409053AE; 0AV409053AG; 0AV409053K

List of parts

| Pos | Part number | OEM no | Quantity | Product name | Info |
|------|--------------------------|------------|----------|------------------|--|
| 'K01 | SP02548 | | 1 piece | Bearing Kit | <p>Contains position 05, 10, 11, 20, 34</p> <p>Information for VAA350+ Audi: Used in 0AV409053H, 0AV409053J, 0AV409053P, 0AV409053Q, 0AV409053S, 0AV409053T, 0AV409053AE, 0AV409053AF</p> <p>Information for VAA350+ SEAT: Used in 0AV409053H, 0AV409053P, 0AV409053S, 0AV409053AE</p> <p>Information for VAA350+ Skoda: Used in 0AV409053H, 0AV409053K, 0AV409053P, 0AV409053R, 0AV409053S, 0AV409053AA, 0AV409053AE, 0AV409053AG</p> <p>Information for VAA350+ VW: Used in 0AV409053H, 0AV409053J, 0AV409053K, 0AV409053P, 0AV409053Q, 0AV409053R, 0AV409053S, 0AV409053T, 0AV409053AA, 0AV409053AE, 0AV409053AF, 0AV409053AG</p> |
| 'K01 | SP02549 | | 1 piece | Bearing Kit | <p>Contains position 05, 10, 11, 20, 34</p> <p>Information for VAA350+ Audi: Used in 02M409053AQ</p> <p>Information for VAA350+ SEAT: Used in 02M409053AQ</p> <p>Information for VAA350+ Skoda: Used in 02M409053AQ, 0AV409053A</p> <p>Information for VAA350+ VW: Used in 02M409053AQ, 0AV409053A</p> |
| 'K02 | SP02550 | | 1 piece | Sealing Kit | <p>Contains position 04, 09, 14, 22, 25, 35</p> |
| 'K20 | SP01504 | 0AV498114 | 1 piece | Shim Set | <p>Contains 25 different Shimms with Dimensions from 1.30mm up to 2.50mm</p> |
| 'K24 | Not available - sold out | 02M409351B | 1 piece | Shaft Flange Kit | <p>Contains position 33, 34, 35, 36</p> <p>Information for VAA350+ Skoda: Used in 0AV409053K</p> <p>Information for VAA350+ VW: Used in 0AV409053K</p> |
| 'K24 | SP02551 | 02M409351A | 1 piece | Shaft Flange Kit | <p>Contains position 33, 34, 35, 36</p> <p>Information for VAA350+ Audi: Used in 0AV409053AE</p> <p>Information for VAA350+ Skoda: Used in 0AV409053AE</p> <p>Information for VAA350+ VW: Used in 0AV409053AE</p> |

Front Axle Drive VAA350+

FD00046, FD00052, FD00054

OEM No: 0AV409053AE; 0AV409053AG; 0AV409053K

List of parts

| Pos | Part number | OEM no | Quantity | Product name | Info |
|------|-----------------------|----------------------------|----------|------------------------|---|
| 'K24 | SP02552 | 02M409351M | 1 piece | Shaft Flange Kit | Contains position 33, 34, 35, 36 Information for VAA350+ Audi: Used in 0AV409053AF Information for VAA350+ Skoda: Used in 0AV409053AG Information for VAA350+ VW: Used in 0AV409053AF, 0AV409053AG |
| 01 | SP00491 | 05143678AA; A2109900151 | 1 piece | Flange Nut | |
| 02 | SP00601 | 02M409273A | 1 piece | Flange | Information for VAA350+ Audi: Used in 02M409053AQ Information for VAA350+ SEAT: Used in 02M409053AQ Information for VAA350+ Skoda: Used in 02M409053AQ, 0AV409053A Information for VAA350+ VW: Used in 02M409053AQ, 0AV409053A |
| 02 | SP00640 | 02M409273D | 1 piece | Flange | Information for VAA350+ Audi: Used in 0AV409053H, 0AV409053J, 0AV409053P, 0AV409053Q, 0AV409053S, 0AV409053T, 0AV409053AE, 0AV409053AF Information for VAA350+ SEAT: Used in 0AV409053H, 0AV409053P, 0AV409053S, 0AV409053AE Information for VAA350+ Skoda: Used in 0AV409053H, 0AV409053K, 0AV409053P, 0AV409053R, 0AV409053S, 0AV409053AA, 0AV409053AE, 0AV409053AG Information for VAA350+ VW: Used in 0AV409053H, 0AV409053J, 0AV409053K, 0AV409053P, 0AV409053Q, 0AV409053R, 0AV409053S, 0AV409053T, 0AV409053AA, 0AV409053AE, 0AV409053AF, 0AV409053AG |
| 03 | SP02553 | 02M409407 | 1 piece | Cap | |
| 04 | SP01684 | 02D525596F | 2 pieces | Radial Seal Ring | |
| 05 | Only available in K01 | | 1 piece | Tapered Roller Bearing | |
| 06 | SP00606 | | 7 pieces | Flange Screw | |
| 07 | Not available | | 1 piece | Cover | |
| 08 | Not available | | 1 piece | Shim | |
| 09 | Only available in K02 | | 1 piece | O-Ring | |
| 10 | Only available in K01 | | 1 piece | Tapered Roller Bearing | |
| 11 | SP00632 | 02M409139 | 1 piece | Needle Sleeve | |

Front Axle Drive VAA350+

FD00046, FD00052, FD00054

OEM No: 0AV409053AE; 0AV409053AG; 0AV409053K

List of parts

| Pos | Part number | OEM no | Quantity | Product name | Info |
|-----|--------------------------|------------|----------|--------------------|---|
| 12 | Not available - sold out | | 1 piece | Bevel Spur Gear | Information for VAA350+ Audi: Used in 02M409053AQ Information for VAA350+ SEAT: Used in 02M409053AQ Information for VAA350+ Skoda: Used in 02M409053AQ, 0AV409053A Information for VAA350+ VW: Used in 02M409053AQ, 0AV409053A |
| 12 | SP00221 | | 1 piece | Bevel Spur Gear | Information for VAA350+ Skoda: Used in 0AV409053R, 0AV409053AA, 0AV409053AG Information for VAA350+ VW: Used in 0AV409053R, 0AV409053AA, 0AV409053AG |
| 12 | SP00628 | | 1 piece | Bevel Spur Gear | Information for VAA350+ Audi: Used in 0AV409053H, 0AV409053J, 0AV409053P, 0AV409053Q, 0AV409053S, 0AV409053T, 0AV409053AE, 0AV409053AF Information for VAA350+ SEAT: Used in 0AV409053H, 0AV409053P, 0AV409053S, 0AV409053AE Information for VAA350+ Skoda: Used in 0AV409053H, 0AV409053K, 0AV409053P, 0AV409053S, 0AV409053AE Information for VAA350+ VW: Used in 0AV409053H, 0AV409053J, 0AV409053K, 0AV409053P, 0AV409053Q, 0AV409053S, 0AV409053T, 0AV409053AE, 0AV409053AF |
| 13 | SP00610 | | 1 piece | Cap | |
| 14 | SP00613 | 09A409529C | 1 piece | Seal Ring | |
| 15 | Not available | | 1 piece | Transportation Cap | |
| 16 | SP00634 | 02H409275A | 1 piece | Sleeve | Information for PL72 ATC: Part additionally requires a Vent Pipe. For details please observe manufacturer regulations. |
| 17 | Not available | | 1 piece | Housing | |

Front Axle Drive VAA350+

FD00046, FD00052, FD00054

OEM No: 0AV409053AE; 0AV409053AG; 0AV409053K

List of parts

| Pos | Part number | OEM no | Quantity | Product name | Info |
|-----|--------------------------|-----------|----------|-----------------|---|
| 18 | SP01998 | 01Z525615 | 1 piece | Magnet | <p>Information for HAA350+ Audi: Used in 0AV525010D, 0AV525010E, 0AV525010F, 0AV525010H, 0AV525010K, 0AV525010L, 0AV525010M, 0BR525010, 0BR525010A, 0BR525010B, 0BR525010C, 0BR525010G, 0BR525010H</p> <p>Information for HAA350+ SEAT: Used in 0AV525010D, 0AV525010E, 0AV525010H, 0AV525010K, 0AV525010L, 0BR525010, 0BR525010B, 0BR525010G</p> <p>Information for HAA350+ Skoda: Used in 0AV525010D, 0AV525010H, 0AV525010K, 0BR525010, 0BR525010B, 0BR525010E, 0BR525010G, 0BR525010J</p> <p>Information for HAA350+ VW: Used in 0AV525010D, 0AV525010E, 0AV525010H, 0AV525010K, 0AV525010L, 0BR525010, 0BR525010B, 0BR525010G</p> <p>Information for PL72 ATC: Used in 95834101001 - 95834101005, 95834101011 - 95834101015, 95834101020 - 95834101024, 95834101030</p> <p>Information for PL72 T Audi: Used in 0BU341010N, 0BU341010P, 0BU341010Q</p> <p>Information for PL72 T Porsche: Used in 95834102001, 95834102002, 95834102011, 0BU341010L, 95834102020</p> <p>Information for PL72 T VW: Used in 0BU341010B, 0BU341010C, 0BU341010D, 0BU341010E, 0BU341010F, 0BU341010L, 0BU341010M, 0BU341010P, 0BU341010R, 0BU341010S, 0BU341010T, 0BU341011, 0BU341011A, 0BU341011C, 0BU341011D, 0BU341011G, 0BU341011H, 0BU341011J, 0BU341011P</p> |
| 19 | Not available - sold out | | 1 piece | Drive Shaft ASM | <p>Information for VAA350+ Audi: Used in 02M409053AQ</p> <p>Information for VAA350+ SEAT: Used in 02M409053AQ</p> <p>Information for VAA350+ Skoda: Used in 02M409053AQ, 0AV409053A, 0AV409053K</p> <p>Information for VAA350+ VW: Used in 02M409053AQ, 0AV409053A, 0AV409053K</p> |

Front Axle Drive VAA350+

FD00046, FD00052, FD00054

OEM No: 0AV409053AE; 0AV409053AG; 0AV409053K

List of parts

| Pos | Part number | OEM no | Quantity | Product name | Info |
|-----|-----------------------|--------|----------|------------------------|--|
| 19 | SP00950 | | 1 piece | Drive Shaft ASM | <p>Information for VAA350+ Audi: Used in 0AV409053H, 0AV409053J, 0AV409053P, 0AV409053Q, 0AV409053S, 0AV409053T, 0AV409053AE, 0AV409053AF</p> <p>Information for VAA350+ SEAT: Used in 0AV409053H, 0AV409053P, 0AV409053S, 0AV409053AE</p> <p>Information for VAA350+ Skoda: Used in 0AV409053H, 0AV409053P, 0AV409053S, 0AV409053AE</p> <p>Information for VAA350+ VW: Used in 0AV409053H, 0AV409053J, 0AV409053P, 0AV409053Q, 0AV409053S, 0AV409053T, 0AV409053AE, 0AV409053AF</p> |
| 19 | SP00951 | | 1 piece | Drive Shaft ASM | <p>Information for VAA350+ Skoda: Used in 0AV409053R, 0AV409053AA, 0AV409053AG</p> <p>Information for VAA350+ VW: Used in 0AV409053R, 0AV409053AA, 0AV409053AG</p> |
| 20 | Only available in K01 | | 2 pieces | Tapered Roller Bearing | |
| 21 | Not available | | 1 piece | Spacer Ring | |
| 22 | Only available in K02 | | 1 piece | O-Ring | |
| 23 | Not available | | 1 piece | Shim | |
| 24 | Not available | | 1 piece | Cover Right | |
| 25 | Only available in K02 | | 2 pieces | Plug | <p>Information for HAA350+ Audi: Used in 0AV525010D, 0AV525010E, 0AV525010F, 0AV525010H, 0AV525010K, 0AV525010L, 0AV525010M, 0BR525010, 0BR525010A, 0BR525010B, 0BR525010C, 0BR525010G, 0BR525010H</p> <p>Information for HAA350+ SEAT: Used in 0AV525010D, 0AV525010E, 0AV525010H, 0AV525010K, 0AV525010L, 0BR525010, 0BR525010B, 0BR525010G</p> <p>Information for HAA350+ Skoda: Used in 0AV525010D, 0AV525010H, 0AV525010K, 0BR525010, 0BR525010B, 0BR525010E, 0BR525010G, 0BR525010J</p> <p>Information for HAA350+ VW: Used in 0AV525010D, 0AV525010E, 0AV525010H, 0AV525010K, 0AV525010L, 0BR525010, 0BR525010B, 0BR525010G</p> |
| 26 | SP00635 | | 4 pieces | Flange Screw | |
| 27 | SP00630 | | 1 piece | Disc | |
| 28 | SP00639 | | 1 piece | Screw | |
| 29 | SP00618 | | 2 pieces | Screw | |

Front Axle Drive VAA350+

FD00046, FD00052, FD00054

OEM No: 0AV409053AE; 0AV409053AG; 0AV409053K

List of parts

| Pos | Part number | OEM no | Quantity | Product name | Info |
|-----|-----------------------|------------|----------|---------------|---|
| 31 | SP00631 | | 1 piece | Adjusting Nut | Information for VAA350+ Audi: Used in 02M409053AQ Information for VAA350+ SEAT: Used in 02M409053AQ Information for VAA350+ Skoda: Used in 02M409053AQ, 0AV409053A Information for VAA350+ VW: Used in 02M409053AQ, 0AV409053A |
| 31 | SP00945 | | 1 piece | Adjusting Nut | Information for VAA350+ Audi: Used in 0AV409053H, 0AV409053J, 0AV409053P, 0AV409053Q, 0AV409053S, 0AV409053T, 0AV409053AE, 0AV409053AF Information for VAA350+ SEAT: Used in 0AV409053H, 0AV409053P, 0AV409053S, 0AV409053AE Information for VAA350+ Skoda: Used in 0AV409053H, 0AV409053K, 0AV409053P, 0AV409053R, 0AV409053S, 0AV409053AA, 0AV409053AE, 0AV409053AG Information for VAA350+ VW: Used in 0AV409053H, 0AV409053J, 0AV409053K, 0AV409053P, 0AV409053Q, 0AV409053R, 0AV409053S, 0AV409053T, 0AV409053AA, 0AV409053AE, 0AV409053AF, 0AV409053AG |
| 33 | SP00619 | 012409419 | 1 piece | Snap Ring | |
| 34 | SP00633 | 012409139A | 2 pieces | Needle Sleeve | |
| 35 | SP00638 | 02M409464 | 1 piece | Quad Ring | |
| 36 | Only available in K24 | | 1 piece | Shaft Flange | |